

PIC32MK General Purpose and Motor Control GPG/MCJ with CAN FD Family Silicon Errata and Data Sheet Clarifications

PIC32MK GPG/MCJ



PIC32MK (GPG/MCJ) Family Errata

The PIC32MK family of devices that you have received conform functionally to the device data sheet, PIC32MK General Purpose and Motor Control (GPG/MCJ) with CAN FD Family Data Sheet (DS60001570D), except for the anomalies described in this document.

The silicon issues discussed in the following pages are for silicon revisions with the Device and Revision IDs listed in the following table. The silicon issues are summarized in the Table of Contents following this section.

The errata described in this document will be addressed in future revisions of the PIC32MK family silicon.

Note: This document summarizes all silicon errata issues from all revisions of silicon, previous as well as current.

Table 1. PIC32MK Family Silicon Device Identification

Part Number	Device Identification (DEVID[27:0])	Revision ID (DEVID[31:28])	
		A1	A2
PIC32MK0512MCJ064	0x6300053	0x1	0x2
PIC32MK0512MCJ048	0x6301053		
PIC32MK0256MCJ064	0x6304053		
PIC32MK0256MCJ048	0x6305053		
PIC32MK0512GPG064	0x6318053		
PIC32MK0512GPG048	0x6319053		
PIC32MK0256GPG064	0x631C053		
PIC32MK0256GPG048	0x631D053		

Data Sheet clarifications and corrections (if applicable) are located in [Data Sheet Clarifications](#), following the discussion of silicon issues.

Table of Contents

PIC32MK (GPG/MCJ) Family Errata	1
1. Silicon Errata Issues Summary.....	3
2. Silicon Errata Issues.....	4
2.1. Oscillator.....	4
2.2. ADC.....	4
2.3. I ² C.....	4
2.4. Flash.....	5
3. Data Sheet Clarifications.....	6
3.1. Packaging.....	6
4. Revision History.....	7
The Microchip Website.....	8
Product Change Notification Service.....	8
Customer Support.....	8
Microchip Devices Code Protection Feature.....	8
Legal Notice.....	8
Trademarks.....	9
Quality Management System.....	10
Worldwide Sales and Service.....	11

1. Silicon Errata Issues Summary

The following errata issues are to be noted for the current device data sheet, PIC32MK General Purpose and Motor Control (GPG/MCJ) with CAN FD Family (DS60001570D).

Table 1-1. Silicon Errata Summary

Module	Feature	Item #	Issue Summary	Affected Revisions	
				A1	A2
Oscillator	Hardware Clock Source Selection	2.1.1	Clock source selection in hardware, that is, using the Fuse Configuration register (FNOSC <2:0> bits (DEVCFG1 <2:0>)) does not work.	X	
ADC	Scan mode	2.2.1	Shared ADC7 on high Offset and Gain Error in Scan mode.	X	
I ² C	Speed	2.3.1	I ² C Host module does not meet low period of the SCL Clock (t _{LOW}) parameter from I ² C specification for clock frequency >= 400 kHz.	X	
I ² C	Client	2.3.2	The 7-bit address that matches the 10-bit upper address value (111_10xx) is not accepted regardless of the STRICT bit setting.	X	
FLASH	RTSP	2.4.1	RTSP of Configuration Words is not functional.	X	X

2. Silicon Errata Issues

The following issues apply to the PIC32MK GPG/MCJ family of devices.

Notes:

- An 'X' indicates the issue is present in this revision of silicon.
- Cells with a dash ('-') indicate that this silicon revision does not exist for this issue.
- Blank cells indicate an issue has been corrected or does not exist in this revision of silicon.

2.1 Oscillator

2.1.1 Hardware Clock Source Selection

After a Brown-out Reset (BOR), the system clock source may default to FRC instead of the clock source defined using the Fuse Configuration register (FNOSC<2:0> bits (DEVCFG1<2:0>)).

Workaround:

Upon any reset, verify if the Current Clock Source Selection register (COSC<2:0> bits (OSCCON<14:12>)) match the clock source selected using the Fuse Configuration register (FNOSC<2:0> bits (DEVCFG1<2:0>)). If the clock sources do not match, perform a software clock switch to the desired clock source. For additional information on software clock switching, refer to Section 42. *Oscillators with Enhanced PLL (DS60001250)*, subsection 42.3.7.2 *Oscillator Switching Sequence* in the "PIC32 Family Reference Manual".

Affected Revisions:

A1	A2						
X							

2.2 ADC

2.2.1 Scan Mode

Shared ADC 7 has high offset and gain error up to 38 LSB in ADC7 Scan mode, as defined in the ADCCSS1/ADCCSS2 registers.

Workaround:

Increase the user-defined SMAC<9:0> bits (ADCCON2<25:16>) sample time register value by 4 T_{AD}. This will reduce the ADC7 throughput that the user must consider, but it will reduce the gain and offset to less than 4 LSB in 12-bit mode.

Affected Revisions:

A1	A2						
X							

2.3 I²C

2.3.1 Speed

The I²C Host module does not meet low period of the SCL clock (t_{LOW}) parameter from I²C specification for clock frequency >= 400 kHz.

Workaround:

None.

Affected Revisions:

A1	A2						
X							

2.3.2 Client

The 7-bit address that matches the 10-bit upper address value (111_10xx) is not accepted regardless of the STRICT bit setting.

Workaround:

None

Affected Revisions:

A1	A2						
X							

2.4 Flash

2.4.1 RTSP

Run-Time Self Programming (RTSP) of Configuration Words is not functional.

Workaround:

None

Affected Revisions:

A1	A2						
X	X						

3. Data Sheet Clarifications

The following typographic corrections and clarifications are to be noted for the current device data sheet, PIC32MK General Purpose and Motor Control (GPG/MCJ) with CAN FD Family (DS60001570**D**), and are showed in **BOLD** type.

3.1 Packaging

The Package Table on page 2 titled 'PIC32MK GPG/MCJ with CAN FD Family' contains an error. It lists the package dimensions of the 48-pin TQFP package as '7 x 7 x .09 mm'. The correct dimensions are '7 x 7 x 1.0 mm'.

Table 3-1. PIC32MK GPG/MCJ with CAN FD Family Packages

Type	VQFN	QFN	TQFP	
Pin Count	48	64	48	64
I/O Pins (up to)	37	53	37	53
Contact / Lead Pitch	0.4 mm	0.50 mm	0.5 mm	0.50 mm
Dimensions	6 x 6 x 0.9 mm	9 x 9 x 1.0 mm	7 x 7 x 1.0 mm	10 x 10 x 1.0 mm

4. Revision History

Revision D - January 2024

The following new Data Sheet Clarification was added:

- [Packaging](#)

Revision C - July 2022

The SPI, I²S, and I²C standards use the terminology "Master" and "Slave". The equivalent Microchip terminology used in this document is "Host" and "Client" respectively. These terms have been updated throughout this document for this revision.

The following silicon errata issues were added:

- [FLASH: 2.4.1 RTSP](#)

Revision B - June 2020

Addition of A1 silicon revision.

The following silicon errata issues were added:

- Oscillator: [2.1.1 Hardware Clock Source Selection](#)
- ADC Scan Mode
- I²C Speed Reference and I²C Client Reference

Revision A - May 2019

This is the initial released version of this document.

The Microchip Website

Microchip provides online support via our website at www.microchip.com/. This website is used to make files and information easily available to customers. Some of the content available includes:

- **Product Support** – Data sheets and errata, application notes and sample programs, design resources, user's guides and hardware support documents, latest software releases and archived software
- **General Technical Support** – Frequently Asked Questions (FAQs), technical support requests, online discussion groups, Microchip design partner program member listing
- **Business of Microchip** – Product selector and ordering guides, latest Microchip press releases, listing of seminars and events, listings of Microchip sales offices, distributors and factory representatives

Product Change Notification Service

Microchip's product change notification service helps keep customers current on Microchip products. Subscribers will receive email notification whenever there are changes, updates, revisions or errata related to a specified product family or development tool of interest.

To register, go to www.microchip.com/pcn and follow the registration instructions.

Customer Support

Users of Microchip products can receive assistance through several channels:

- Distributor or Representative
- Local Sales Office
- Embedded Solutions Engineer (ESE)
- Technical Support

Customers should contact their distributor, representative or ESE for support. Local sales offices are also available to help customers. A listing of sales offices and locations is included in this document.

Technical support is available through the website at: www.microchip.com/support

Microchip Devices Code Protection Feature

Note the following details of the code protection feature on Microchip products:

- Microchip products meet the specifications contained in their particular Microchip Data Sheet.
- Microchip believes that its family of products is secure when used in the intended manner, within operating specifications, and under normal conditions.
- Microchip values and aggressively protects its intellectual property rights. Attempts to breach the code protection features of Microchip product is strictly prohibited and may violate the Digital Millennium Copyright Act.
- Neither Microchip nor any other semiconductor manufacturer can guarantee the security of its code. Code protection does not mean that we are guaranteeing the product is "unbreakable". Code protection is constantly evolving. Microchip is committed to continuously improving the code protection features of our products.

Legal Notice

This publication and the information herein may be used only with Microchip products, including to design, test, and integrate Microchip products with your application. Use of this information

in any other manner violates these terms. Information regarding device applications is provided only for your convenience and may be superseded by updates. It is your responsibility to ensure that your application meets with your specifications. Contact your local Microchip sales office for additional support or, obtain additional support at www.microchip.com/en-us/support/design-help/client-support-services.

THIS INFORMATION IS PROVIDED BY MICROCHIP "AS IS". MICROCHIP MAKES NO REPRESENTATIONS OR WARRANTIES OF ANY KIND WHETHER EXPRESS OR IMPLIED, WRITTEN OR ORAL, STATUTORY OR OTHERWISE, RELATED TO THE INFORMATION INCLUDING BUT NOT LIMITED TO ANY IMPLIED WARRANTIES OF NON-INFRINGEMENT, MERCHANTABILITY, AND FITNESS FOR A PARTICULAR PURPOSE, OR WARRANTIES RELATED TO ITS CONDITION, QUALITY, OR PERFORMANCE.

IN NO EVENT WILL MICROCHIP BE LIABLE FOR ANY INDIRECT, SPECIAL, PUNITIVE, INCIDENTAL, OR CONSEQUENTIAL LOSS, DAMAGE, COST, OR EXPENSE OF ANY KIND WHATSOEVER RELATED TO THE INFORMATION OR ITS USE, HOWEVER CAUSED, EVEN IF MICROCHIP HAS BEEN ADVISED OF THE POSSIBILITY OR THE DAMAGES ARE FORESEEABLE. TO THE FULLEST EXTENT ALLOWED BY LAW, MICROCHIP'S TOTAL LIABILITY ON ALL CLAIMS IN ANY WAY RELATED TO THE INFORMATION OR ITS USE WILL NOT EXCEED THE AMOUNT OF FEES, IF ANY, THAT YOU HAVE PAID DIRECTLY TO MICROCHIP FOR THE INFORMATION.

Use of Microchip devices in life support and/or safety applications is entirely at the buyer's risk, and the buyer agrees to defend, indemnify and hold harmless Microchip from any and all damages, claims, suits, or expenses resulting from such use. No licenses are conveyed, implicitly or otherwise, under any Microchip intellectual property rights unless otherwise stated.

Trademarks

The Microchip name and logo, the Microchip logo, Adaptec, AVR, AVR logo, AVR Freaks, BesTime, BitCloud, CryptoMemory, CryptoRF, dsPIC, flexPWR, HELDO, IGLOO, JukeBlox, KeeLoq, Kleer, LANCheck, LinkMD, maXStylus, maXTouch, MediaLB, megaAVR, Microsemi, Microsemi logo, MOST, MOST logo, MPLAB, OptoLyzer, PIC, picoPower, PICSTART, PIC32 logo, PolarFire, Prochip Designer, QTouch, SAM-BA, SenGenuity, SpyNIC, SST, SST Logo, SuperFlash, Symmetricom, SyncServer, Tachyon, TimeSource, tinyAVR, UNI/O, Vectron, and XMEGA are registered trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

AgileSwitch, ClockWorks, The Embedded Control Solutions Company, EtherSynch, Flashtec, Hyper Speed Control, HyperLight Load, Libero, motorBench, mTouch, Powermite 3, Precision Edge, ProASIC, ProASIC Plus, ProASIC Plus logo, Quiet-Wire, SmartFusion, SyncWorld, TimeCesium, TimeHub, TimePictra, TimeProvider, and ZL are registered trademarks of Microchip Technology Incorporated in the U.S.A.

Adjacent Key Suppression, AKS, Analog-for-the-Digital Age, Any Capacitor, AnyIn, AnyOut, Augmented Switching, BlueSky, BodyCom, Clockstudio, CodeGuard, CryptoAuthentication, CryptoAutomotive, CryptoCompanion, CryptoController, dsPICDEM, dsPICDEM.net, Dynamic Average Matching, DAM, ECAN, Espresso T1S, EtherGREEN, EyeOpen, GridTime, IdealBridge, IGaT, In-Circuit Serial Programming, ICSP, INICnet, Intelligent Paralleling, IntelliMOS, Inter-Chip Connectivity, JitterBlocker, Knob-on-Display, MarginLink, maxCrypto, maxView, memBrain, Mindi, MiWi, MPASM, MPF, MPLAB Certified logo, MPLIB, MPLINK, mSiC, MultiTRAK, NetDetach, Omniscient Code Generation, PICDEM, PICDEM.net, PCKit, PICtail, Power MOS IV, Power MOS 7, PowerSmart, PureSilicon, QMatrix, REAL ICE, Ripple Blocker, RTAX, RTG4, SAM-ICE, Serial Quad I/O, simpleMAP, SimpliPHY, SmartBuffer, SmartHLS, SMART-I.S., storClad, SQI, SuperSwitcher, SuperSwitcher II, Switchtec, SynchroPHY, Total Endurance, Trusted Time, TSHARC, Turing, USBCheck, VariSense, VectorBlox, VeriPHY, ViewSpan, WiperLock, XpressConnect, and ZENA are trademarks of Microchip Technology Incorporated in the U.S.A. and other countries.

SQTP is a service mark of Microchip Technology Incorporated in the U.S.A.

The Adaptec logo, Frequency on Demand, Silicon Storage Technology, and Symmcom are registered trademarks of Microchip Technology Inc. in other countries.

GestIC is a registered trademark of Microchip Technology Germany II GmbH & Co. KG, a subsidiary of Microchip Technology Inc., in other countries.

All other trademarks mentioned herein are property of their respective companies.

© 2024, Microchip Technology Incorporated and its subsidiaries. All Rights Reserved.

ISBN: 978-1-6683-3897-1

Quality Management System

For information regarding Microchip's Quality Management Systems, please visit www.microchip.com/quality.

Worldwide Sales and Service

AMERICAS	ASIA/PACIFIC	ASIA/PACIFIC	EUROPE
<p>Corporate Office 2355 West Chandler Blvd. Chandler, AZ 85224-6199 Tel: 480-792-7200 Fax: 480-792-7277 Technical Support: www.microchip.com/support Web Address: www.microchip.com</p> <p>Atlanta Duluth, GA Tel: 678-957-9614 Fax: 678-957-1455</p> <p>Austin, TX Tel: 512-257-3370</p> <p>Boston Westborough, MA Tel: 774-760-0087 Fax: 774-760-0088</p> <p>Chicago Itasca, IL Tel: 630-285-0071 Fax: 630-285-0075</p> <p>Dallas Addison, TX Tel: 972-818-7423 Fax: 972-818-2924</p> <p>Detroit Novi, MI Tel: 248-848-4000</p> <p>Houston, TX Tel: 281-894-5983</p> <p>Indianapolis Noblesville, IN Tel: 317-773-8323 Fax: 317-773-5453 Tel: 317-536-2380</p> <p>Los Angeles Mission Viejo, CA Tel: 949-462-9523 Fax: 949-462-9608 Tel: 951-273-7800</p> <p>Raleigh, NC Tel: 919-844-7510</p> <p>New York, NY Tel: 631-435-6000</p> <p>San Jose, CA Tel: 408-735-9110 Tel: 408-436-4270</p> <p>Canada - Toronto Tel: 905-695-1980 Fax: 905-695-2078</p>	<p>Australia - Sydney Tel: 61-2-9868-6733</p> <p>China - Beijing Tel: 86-10-8569-7000</p> <p>China - Chengdu Tel: 86-28-8665-5511</p> <p>China - Chongqing Tel: 86-23-8980-9588</p> <p>China - Dongguan Tel: 86-769-8702-9880</p> <p>China - Guangzhou Tel: 86-20-8755-8029</p> <p>China - Hangzhou Tel: 86-571-8792-8115</p> <p>China - Hong Kong SAR Tel: 852-2943-5100</p> <p>China - Nanjing Tel: 86-25-8473-2460</p> <p>China - Qingdao Tel: 86-532-8502-7355</p> <p>China - Shanghai Tel: 86-21-3326-8000</p> <p>China - Shenyang Tel: 86-24-2334-2829</p> <p>China - Shenzhen Tel: 86-755-8864-2200</p> <p>China - Suzhou Tel: 86-186-6233-1526</p> <p>China - Wuhan Tel: 86-27-5980-5300</p> <p>China - Xian Tel: 86-29-8833-7252</p> <p>China - Xiamen Tel: 86-592-2388138</p> <p>China - Zhuhai Tel: 86-756-3210040</p>	<p>India - Bangalore Tel: 91-80-3090-4444</p> <p>India - New Delhi Tel: 91-11-4160-8631</p> <p>India - Pune Tel: 91-20-4121-0141</p> <p>Japan - Osaka Tel: 81-6-6152-7160</p> <p>Japan - Tokyo Tel: 81-3-6880-3770</p> <p>Korea - Daegu Tel: 82-53-744-4301</p> <p>Korea - Seoul Tel: 82-2-554-7200</p> <p>Malaysia - Kuala Lumpur Tel: 60-3-7651-7906</p> <p>Malaysia - Penang Tel: 60-4-227-8870</p> <p>Philippines - Manila Tel: 63-2-634-9065</p> <p>Singapore Tel: 65-6334-8870</p> <p>Taiwan - Hsin Chu Tel: 886-3-577-8366</p> <p>Taiwan - Kaohsiung Tel: 886-7-213-7830</p> <p>Taiwan - Taipei Tel: 886-2-2508-8600</p> <p>Thailand - Bangkok Tel: 66-2-694-1351</p> <p>Vietnam - Ho Chi Minh Tel: 84-28-5448-2100</p>	<p>Austria - Wels Tel: 43-7242-2244-39 Fax: 43-7242-2244-393</p> <p>Denmark - Copenhagen Tel: 45-4485-5910 Fax: 45-4485-2829</p> <p>Finland - Espoo Tel: 358-9-4520-820</p> <p>France - Paris Tel: 33-1-69-53-63-20 Fax: 33-1-69-30-90-79</p> <p>Germany - Garching Tel: 49-8931-9700</p> <p>Germany - Haan Tel: 49-2129-3766400</p> <p>Germany - Heilbronn Tel: 49-7131-72400</p> <p>Germany - Karlsruhe Tel: 49-721-625370</p> <p>Germany - Munich Tel: 49-89-627-144-0 Fax: 49-89-627-144-44</p> <p>Germany - Rosenheim Tel: 49-8031-354-560</p> <p>Israel - Ra'anana Tel: 972-9-744-7705</p> <p>Italy - Milan Tel: 39-0331-742611 Fax: 39-0331-466781</p> <p>Italy - Padova Tel: 39-049-7625286</p> <p>Netherlands - Drunen Tel: 31-416-690399 Fax: 31-416-690340</p> <p>Norway - Trondheim Tel: 47-72884388</p> <p>Poland - Warsaw Tel: 48-22-3325737</p> <p>Romania - Bucharest Tel: 40-21-407-87-50</p> <p>Spain - Madrid Tel: 34-91-708-08-90 Fax: 34-91-708-08-91</p> <p>Sweden - Gothenberg Tel: 46-31-704-60-40</p> <p>Sweden - Stockholm Tel: 46-8-5090-4654</p> <p>UK - Wokingham Tel: 44-118-921-5800 Fax: 44-118-921-5820</p>